

TO START, & ALARM C.T. SAW 91050 OR EQUIV.

P.A.B.X. NO 3 ONLY

EARTH ETH. R (1A) UP
BAR 22 SWG (P.A.B.X. NO 3 ONLY)

BATT. FUSE BK (1B) U12.
22 SWG (P.A.B.X. NO 3 ONLY)

EARTH R.: U11-AP21-API-PA22-PA2-P57j1-ZP2-ZP23-
ZP25-ZP27-ZP1-ZP6-ZP8-C1a-R6a-C2c-R1a-
C4a-TJ7

BATT. W.: U12-AP2-RX1b-X2-Zb-Ze-P52LYe-R6b
RX2b-R6b

TO RINGING VIBRATOR, & TONE C.T. SAW 81060 OR EQUIV

(RX2)


TJ

F.E.

WARN PULSE

Z PULSE

PULSE

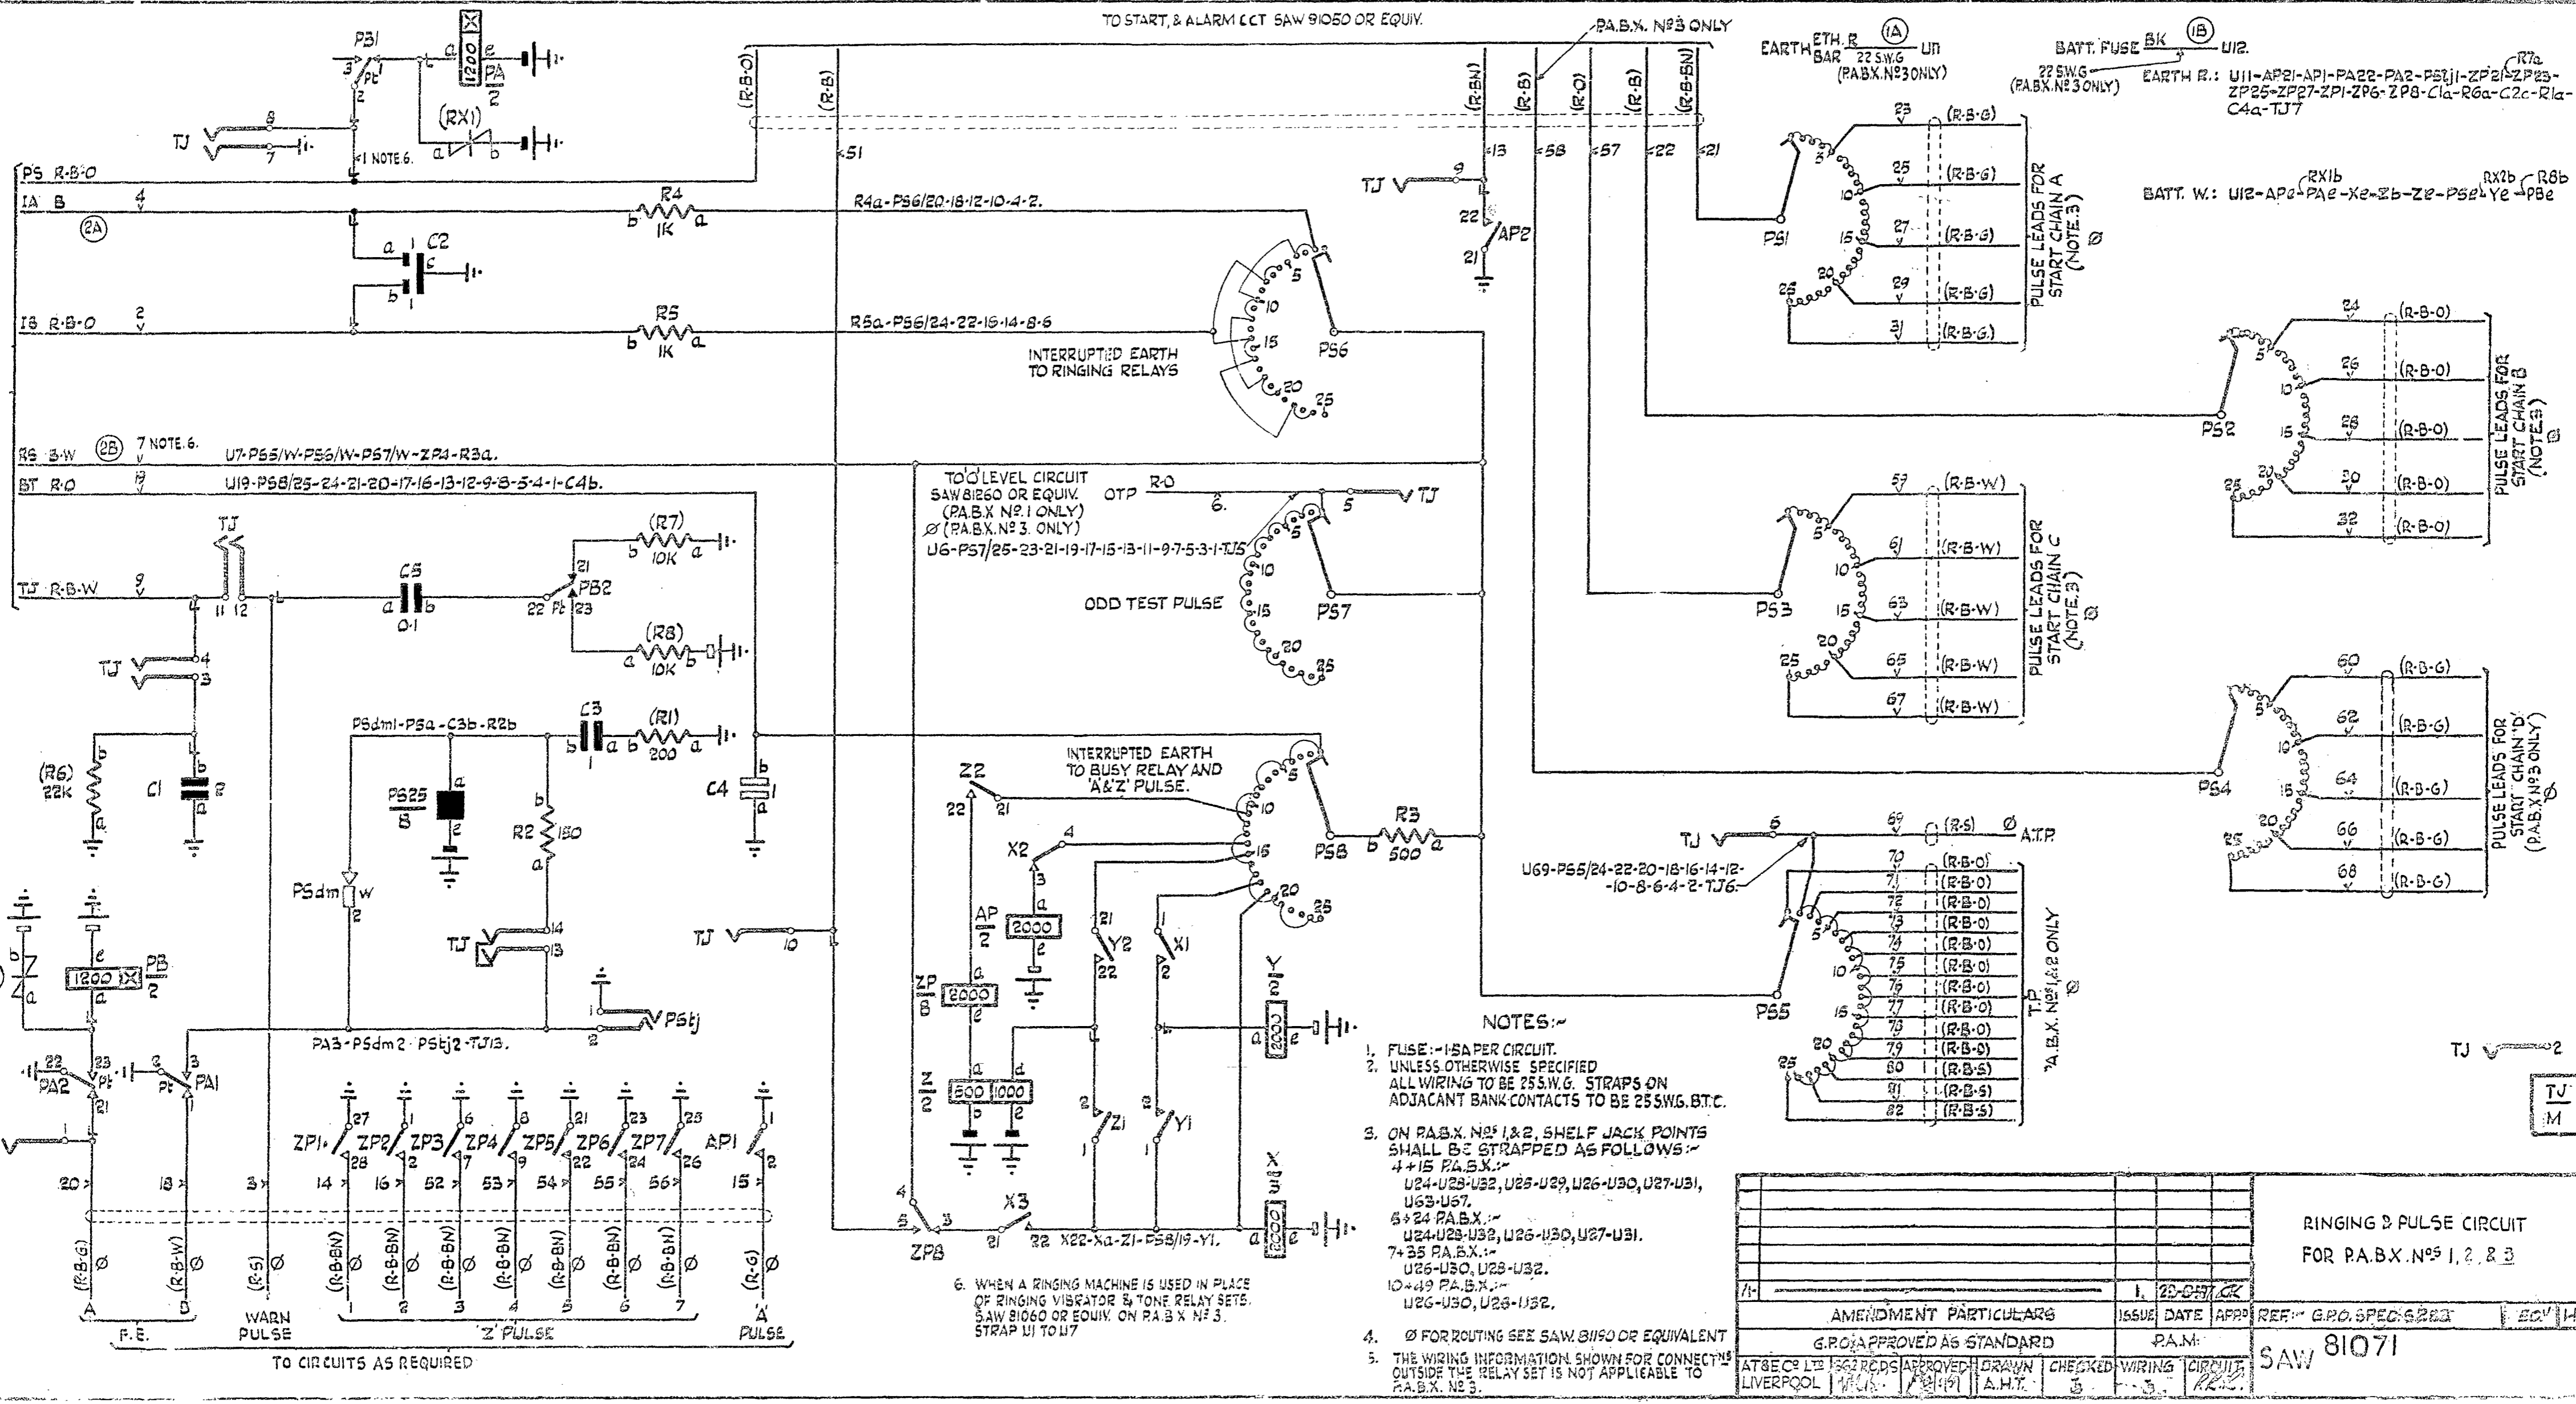

TO 'O' LEVEL CIRCUIT
SAW 81260 OR EQUIV.
(P.A.B.X. NO 1 ONLY)
Ø (P.A.B.X. NO 3 ONLY)
U6-P57/25-23-21-19-17-15-13-11-9-7-5-3-1-TJ5


ODD TEST PULSE

INTERRUPTED EARTH
TO BUSY RELAY AND
'A&Z' PULSE.

NOTES:-

1. FUSE:-1.5A PER CIRCUIT.
2. UNLESS OTHERWISE SPECIFIED ALL WIRING TO BE 25S.W.G. STRAPS ON ADJACENT BANK CONTACTS TO BE 25S.W.G. B.T.C.
3. ON P.A.B.X. NO 1 & 2, SHELF JACK POINTS SHALL BE STRAPPED AS FOLLOWS:-
4+15 P.A.B.X.:-
U24-U28-U32, U25-U29, U26-U30, U27-U31, U63-U67.
6+24 P.A.B.X.:-
U24-U28-U32, U26-U30, U27-U31.
7+35 P.A.B.X.:-
U26-U30, U29-U32.
10+49 P.A.B.X.:-
U26-U30, U29-U32.
4. Ø FOR ROUTING SEE SAW 81150 OR EQUIVALENT
5. THE WIRING INFORMATION SHOWN FOR CONNECTIONS OUTSIDE THE RELAY SET IS NOT APPLICABLE TO P.A.B.X. NO 3.

6. WHEN A RINGING MACHINE IS USED IN PLACE OF RINGING VIBRATOR & TONE RELAY SETS, SAW 81060 OR EQUIV. ON P.A.B.X. NO 3, STRAP U1 TO U7

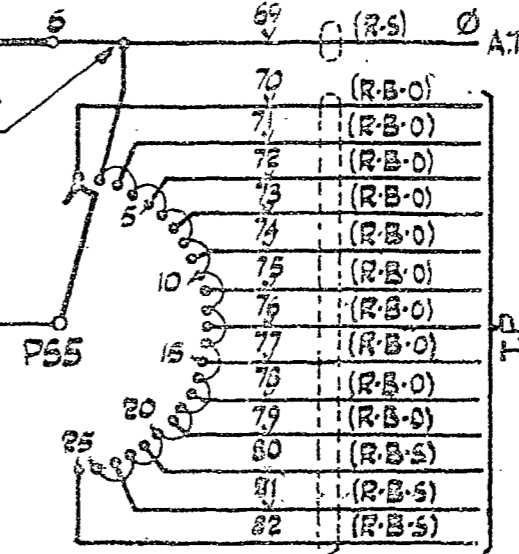

T.P. P.A.B.X. NO 1 & 2 ONLY

AMENDMENT PARTICULARS		ISSUE DATE	APP'D	REF. G.P.O. SPEC. 6223	EDV H
G.P.O. APPROVED AS STANDARD					
AT&CO LTD 1562 R.D.S. APPROVED DRAWN					
LIVERPOOL					

RINGING & PULSE CIRCUIT FOR P.A.B.X. NO 1, 2 & 3

SAW 81071